

Hyundai Staria

Wagon, 7 seater, 5 doors From July 2021














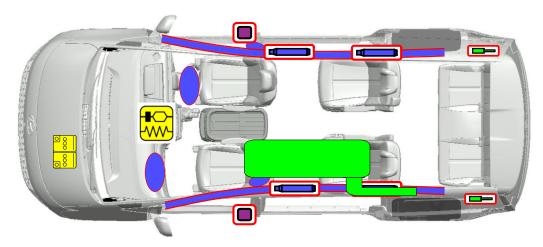

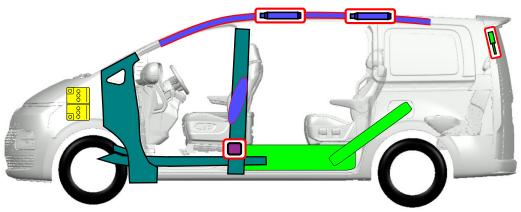

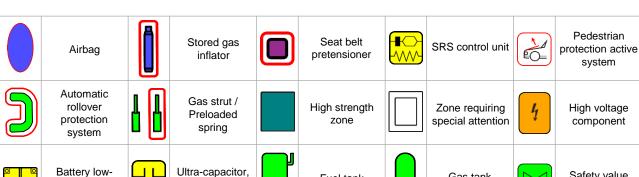

Battery pack, high-voltage

voltage

Fuel tank High voltage device that

disconnects

high voltage



Gas tank



Safety value

High voltage power cable

low voltage



0

Fuse box disabling high voltage



High voltage ultra capacitor

1. Identification / recognition





2. Immobilisation / stabilisation / lifting

■ Immobilisation








- 1. push the P button
- 2. Pull the switch to set the parking brake.

■ Lifting positions at car underbody



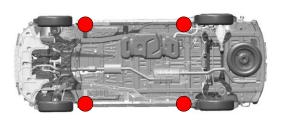



Do not place cribbing such as wooden blocks or rescue air lifting bags under the exhaust system, fuel system or high voltage power cables. The failure will cause of fire, electric shock or gas leak.


3. Disable direct hazards / safety regulations

■ Access to 12V battery





12 V

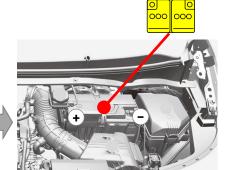



1. Pull the release lever to unlatch the hood. The hood should pop open slightly.

2. Go to the front of the vehicle, raise the hood slightly, push the secondary latch (1) up side and lift the hood (2).

Battery in the engine room

- Disabling procedure
 - 1 Turn the ignition switch off



(2) Disconnect the negative(-) terminal



(3) Disconnect the positive(+) terminal


■ Glass

1: Laminated 2-5: Tempered





■ Vehicle body

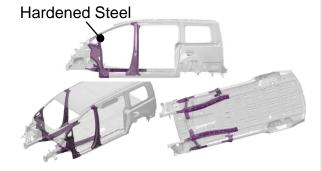

■ Steering column adjustment ■ Seat adjustment

Manual type



- Pull down the lock release lever(1)
- Adjust the steering wheel angle (2) and height((3))

1st row: Mechanical 2nd row: Mechanical



3rd row: Mechanical





ID No. KMH-US4-RSI-01-202203 Version No.

Version date 03/2022

Page 3 of 4

5. Stored energy / liquids / gases / solids




6. In case of fire

■ Gas Strut




Risk of missile effect of tailgate.



8. Towing / transportation / storage

OK:

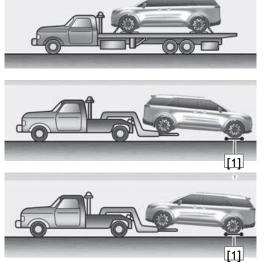

Not OK:





[1] : Dolly

Notice: AWD (All Wheel Drive) vehicle must be towed with all wheels off the ground, either on a flatbed tow truck or using dollies.

01